

6099070

NAF Bruktbiltest

Testdato
19.02.2026

Kunde

Navn	Auksjonen.no Co/Santander
Medlemsnummer	95140190
Adresse	Døvleveien 23
Postnummer og -sted	3170 SEM
Telefon	33300540
Ekstern referanse	531468



Kjøretøy

Bilmerke	Peugeot	Motorstørrelse	- cm ³
Modell	208	Motoreffekt	100 kW
Type	U	Aksler i drift	1
Registreringsnr.	EE15263	Drivstofftype	Elektrisk
Understellsnr.	VR3UHZKXZMT046730	Kjøretøygruppe	101
Km.stand.	36177	Bruktimportert	Ja
Farge	Gul	Registreringsår	2021
Karosseritype	Kombikupé	Registrert første gang	31.08.2021
		Frist for neste EU kontroll	30.08.2025



Informasjon

NAF Bruktbiltest (BBT) er en uavhengig vurdering av kjøretøyets tekniske tilstand iht. definerte kontrollpunkter. De aktuelle kontrollpunktene fremkommer i testen og vurderes / bedømmes etter NAF sine definisjoner og retningslinjer som også hensyntar bilens alder og km-stand.

NAF anmerker kun feil, mangler og avvik som avdekkes på testtidspunktet. Forutsetninger for utført test er angitt på side 2 i denne rapporten. NAF demonterer ikke for kontroll. Det kan være indikasjon knyttet til tekniske forhold som krever ytterligere utredning for å kunne fastslå omfang. Det kan også være periodiske feil som ikke kan avdekkes på testtidspunktet. Se utfyllende leveransebeskrivelse side 6.

NAF Bruktbiltest er utført på oppdrag av bilforhandler. Alle henvendelser til testen og øvrige forhold til bilens tekniske tilstand må avklares mellom kjøper av bilen og bilforhandler testen er utstedt til.



6099070

Testresultater

Ref.Id	Repareres	Resultat	Beskrivelse
1.11	Kjøreegenskaper	* Ikke prøvekjørt pga feil på driftsystem.	
3.3	Nøkler / Utstyr	Nøkkel mangler 1 stk	
4.8	Service/ Dokum.	Aktivert serviceindikator	
4.9		Frist for EU kontroll er overskredet	
6.10	Bremseskiver	Rust på bremseskive:	Venstre bak, Høyre bak
21.3	Varsellamper	Varsellampe for SRS (airbag) lyser	
21.17		* Feil med elektrisk driftssystem.	
22.2	Varsellamper utvidet	Varsellampe for TPMS (Dekktrykk) lyser	
23.1	Full systemskann	Det finnes feilkoder, se rapport	
58.6	Tilstand 12 volt batteri	Bør lade batteri	
61.6	Ladekontakt elbil/hybrid	* Kommer feilmelding når forsøker å lade.	
62.2	Ladekabel elbil/hybrid	Ladekabel mangler	
65.11	Dekk	Mønsterdybde under 1,6 mm for sommerdekk, eller 3,0 mm for vinterdekk:	Venstre foran, Høyre foran
67.8	Ekstra hjulsett	Ekstra hjulsett mangler	
81.4	Frontrute	Sprekk i frontrute: • Reparasjonsmetode:Skift	
86.3	Lakk / karosseri utvendig	Lakkriper:	Høyre fordør, Høyre baksjerm
86.6		Bulk (er):	Høyre bakdør, Venstre baksjerm, Høyre fordør, Høyre baksjerm
Ref.Id	Opplysning	Resultat	Beskrivelse
6.16	Bremseskiver	Overflaterust eller mindre enn 25% av overflaten rustet	Begge sider foran
23.7	Full systemskann	Diagnoseavlesing ligger i testrapport	
48.6	Oppvarmet bakrute	Ikke funksjonsprøvd grunnet høy utetemperatur	
86.21	Lakk / karosseri utvendig	Diverse småbulker/lakkriper	

Ikke utførte

Punkt	Årsak
Motor virkemåte	Bilen er ikke prøvekjørt
Girkasse (automatisk)	Bilen er ikke prøvekjørt

Servicehistorikk

Servicehistorikk er vedlagt

Testforhold

Føreforhold ved prøvekjøring


Bilen ble prøvekjørt:

Er bilen skitten eller nediset:

Nei

Bilen har ikke blitt prøvekjørt pga:

feil på driftsystem.

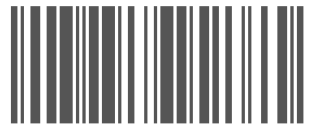

6099070

Prøvekjøring	Elektriske anlegg
1 - Kjøreegenskaper	R 44 - Instrument belysning ✓
Generell informasjon	45 - Instrumenter ✓
3 - Nøkler / Utstyr	46 - Radio / Multimedia ✓
4 - Service/ Dokum.	47 - Elektrisk vindusheis ✓
Bremser	48 - Oppvarmet bakrute O
5 - Bremsbelegg	49 - Kupevifte ✓
6 - Bremseskiver	✓ 50 - Varmeapparat / klimaanlegg (AC) ✓
8 - Parkeringsbrems	R 51 - Vindusvisker, spyler (foran/bak) ✓
9 - Bremsvirkning	✓ 52 - Lyktespyler / Visker ✓
10 - Bremsvæsknivå	✓ 53 - Sentrallås ✓
11 - Bremsvæskens kokepunkt	✓ 54 - Setevarmer ✓
12 - Bremserør	✓ 57 - Batteri ytre tilstand ✓
13 - Bremseslanger	✓ 58 - Tilstand 12 volt batteri R
14 - Bremskraftforsterker	✓ 61 - Ladekontakt elbil/hybrid R
15 - Bremsedal	✓ 62 - Ladekabel elbil/hybrid R
Lys og signaler	✓ 63 - Kabler for fremdriftssystem elbil/hybrid ✓
17 - Lys	64 - Utv. tilstand fremdriftsbatteri elbil/hybrid ✓
19 - Refleks	Hjul, dekk, felg
20 - Lyd / lyssignaler	✓ 65 - Dekk R
21 - Varsellamper	✓ 66 - Felg ✓
22 - Varsellamper utvidet	R 67 - Ekstra hjulsett R
e-Diagnose	R 68 - Hjullager ✓
23 - Full systemskann	69 - Reservehjul / dekkreparasjonssett ✓
Motor	70 - Hjulskapsler/navkopper ✓
27 - Motor virkemåte	Styring
28 - Utvendig tilstand motor	71 - Ratt, rattaksel, ledd ✓
30 - Kjølevæske	72 - Styresnekke, tannstang ✓
31 - Kjølevifte	73 - Styrestag/ledd ✓
32 - Kjølesystem	74 - Styreservo ✓
35 - Motorfester	Hjuloppheng
Drivverk	✓ 75 - Støtdempere ✓
40 - Girkasse (automatisk)	76 - Stabilisator ✓
41 - Differensial	77 - Fjærer / fjærbein ✓
42 - Drivaksler	✓ 78 - Opphengs- / bærearmer foraksel ✓
	79 - Opphengs- / bærearmer bakaksel ✓
	80 - Travers ✓



6099070

Karosseri

81 - Frontrute	R
82 - Siderute/bakrute	✓
83 - Dør-/panseråpner	✓
84 - Lås	✓
86 - Lakk / karosseri utvendig	R
87 - Utvendig speil	✓
88 - Underside	✓
89 - Understellsnummer	✓

Interiør

91 - Dashbord / midtkonsoll	✓
92 - Luftdyse kupé	✓
93 - Taktrekk	✓
94 - Solskjerm	✓
95 - Innvendig speil	✓
96 - Dørtrekk	✓
97 - Døråpning	✓
98 - Seter	✓
99 - Bilbelte	✓
100 - Gulvmatter/-teppe	✓
101 - Bagasjeromstildekning	✓
102 - Laste-/bagasjerom	✓
103 - Interiør generelt	✓
104 - Varseltrekant	✓



6099070

Måleverdier

Ref.Id	Punkt	Fråse	Måleverdi
3.1	Nøkler / Utstyr	Antall nøkler:	1 stk
6	Bremseskiver		Ikke mulig å måle uten demontering
9	Bremsevirkning		Kontrollert visuelt
30.1	Kjølevæske	Kjølevæskens frysepunkt, frostsikker ned til minus:	35 °C
50.1	Varmeapparat / klimaanlegg (AC)	Temperatur på luft inn i klimaanlegg	20 °C
50.2		Temperatur på luft ut av klimaanlegg	10 °C
58	Tilstand 12 volt batteri		Kontrollert visuelt
62.1	Ladekabel elbil/hybrid	Antall ladekabler i bilen:	0 stk
65.1	Dekk	Mønsterdybde VF	2,50 mm
65.2		Mønsterdybde HF	2,50 mm
65.3		Mønsterdybde VB	6,50 mm
65.4		Mønsterdybde HB	7,50 mm
65.5		Bilen er utrustet med:	Piggfrie vinterdekk
66.1	Felg	Felg montert på bilen:	Lettmetallfelg
67	Ekstra hjulsett		Ligger ikke i bilen



6099070

Leveransebetingelser

1. Testrapporten

Testrapporten inneholder identifikasjon av kjøretøy og kunde samt beskrivelse av testens omfang med måleresultater der det foreligger.

2. Bedømming–vurderingsdefinisjon

Forklaring til bokstavkodene som benyttes ved PDF rapport:

V = Normalt. Tilstand vurdert «normal» iht. kjøretøyets alder og kjørelengde

R = Reparasjon. Anbefaler utbedring iht. kontrollpunkt

O = Opplysning. Informasjon iht. kontrollpunkt og/eller kjøretøy

S = Skiftet. Kontrollpunkt inkl. komponentskifte

J = Justert. Kontrollpunkt inkl. justering

I = Ikkeutført. Kontrollpunkt ikke vurdert

3. Gjennomføring av test.

Test utføres på et NAF Senter hvis ikke annet er beskrevet.

4. Eiendomsrett

Testens resultat tilhører NAFs kunde. Kundens navn er registrert på side 1 i testrapporten, og eventuelle henvendelser i forbindelse med testen må utføres av registrert kunde. Testresultatene leveres ikke ut til andre uten samtykke fra NAFs kunde.

5. Demontering

NAF demonterer ikke for kontroll/vurdering, og kan dermed ikke påpeke feil som kun avdekkes ved demontering. Dersom NAF oppdager avvik der det trengs demontering for kontroll/vurdering, vil dette anmerkes i testrapporten.

6. Prøvekjøring, periodiske feil og fremtidige problemer

NAF anmerker kun feil og avvik som oppdages på testtidspunktet. Periodiske feil/avvik kan forekomme uten at dette avdekkes pga. manglende symptom(fremtredelse) ved testtidspunktet. Det er ikke mulig å forutse framtidige problemer, feil eller avvik.

NAF prøvekjører bilen kun i begrenset grad.

7. Avlesing av elektronisk lagrede feilkoder via kjøretøyets OBD kontakt

NAF leser feilkoder på de elektroniske styresystemene som bilprodusenten har gitt tilgang til. Tilgang kan variere mellom ulike bilmerker og modeller og systemene leses med det testutstyret som benyttes av NAF. Det skilles ikke mellom permanente og periodiske feilkoder. NAF kan ikke påvise avvik i bilens oppgitte kilometerstand ved hjelp av diagnose.

8. NAFs ansvar

NAF har vurdert alle kontrollpunkter i den aktuelle testrapporten i henhold til NAFs definisjoner og retningslinjer. Kontrollpunkter som ikke omtales i rapporten er ikke inkludert eller vurdert.

Feil/avvik som avdekkes i etterkant av testen, kan ikke lastes NAF uten at det dokumenteres at følgende kumulative vilkår foreligger:

- feil/avvik må anses å ha foreligget ved testtidspunktet
- feil/avvik kan avdekkes etter gjeldende definisjoner og retningslinjer(innhold) av kontrollpunkt ved testtidspunktet
- feil/avvik kan avdekkes ved benyttet testutstyr i NAF ved testtidspunktet
- feil/avvik kan avdekkes ved gjeldende testforutsetninger ved testtidspunktet
- feil/avvik medfører konsekvenstap
- NAF har opptrådt uaktsomt ved testtidspunktet

9. Klageadgang næringsmarked

Testens resultat tilhører NAFs kunde. Kundens navn er registrert på side 1 i testrapporten. Ved eventuelle uoverensstemmelser i forbindelse med levert dokumentasjon, skal kunde ta dette opp med NAF. NAF er forretningsmessig leverandør til kunde og forholder seg kun til denne avtalepart.

Alle reklamasjoner må være NAF i hende skriftlig senest 10 dager etter at testen er utført.

10. Reklamasjonsansvaret til NAF

Ved uoverensstemmelse mellom tekst og bilder i testrapport og ett av disse viser riktig tilstand, er feilen ikke reklamasjonsgrunn.

NAF AS er ikke ansvarlig for feil i opplysninger som er hentet elektronisk fra 3. -part.

NAF AS kan kreve at bilen stilles til disposisjon for kontroll.

Ved reklamasjon kan NAF AS forlange å få mulighet til å reparere på eget verksted.

Hvis kjøper starter reparasjon på annet verksted uten skriftlig godkjenning fra NAF AS bortfaller retten til å kreve utgiften refundert av NAF AS.

Ved reparasjon på kjøpers verksted beregnes priser etter NAF AS sine innkjøpspriser (Meca eller tilsvarende) og selvkost på timepris. Benyttes DBS-systemet som grunnlag for delepriser benyttes importørpriser uten fraktpåslag.

Arbeidstidsettes iht. Haynes Pro med faktor 1

Diagnoserapport vedlegges der kunden har bestilt dette. Diagnoserapporten betraktes som en del av testrapporten.


Reklamasjonskravets størrelse er under alle omstendigheter oppad begrenset til prisen på testen, med mindre noe annet er særskilt avtalt.

NAF AS anbefaler at budgivere selv inspiserer objektet.




6099070

Bilder og vedlegg

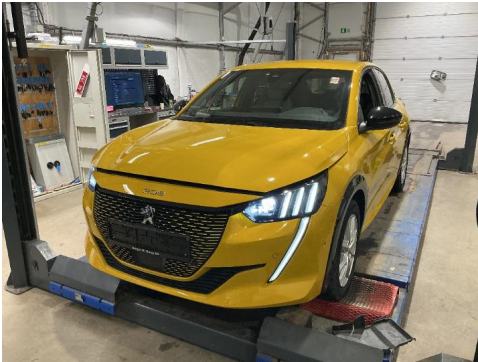

1. Generelt

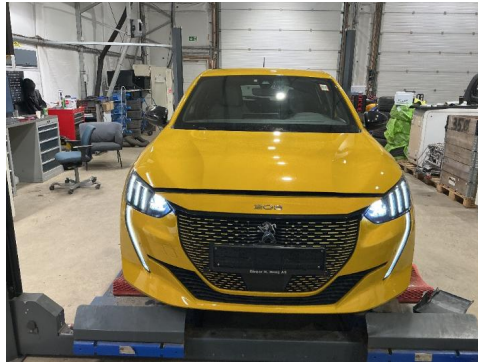

2. Generelt



3. Generelt




4. Generelt



5. Generelt



6. Generelt

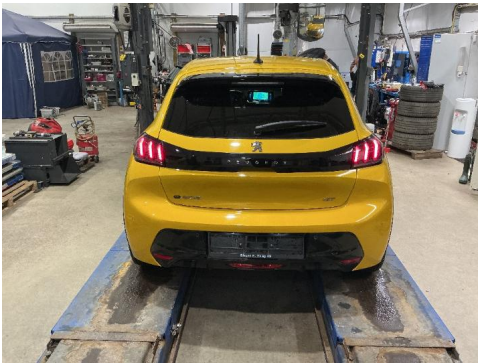

7. Generelt



8. Generelt



9. Generelt



10. Generelt



11. Generelt



12. Generelt



6099070

Bilder og vedlegg




13. Generelt



14. Generelt



15. Generelt

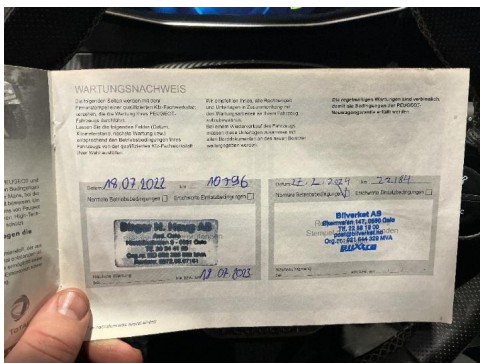


16. Generelt




17. Generelt




18. Generelt

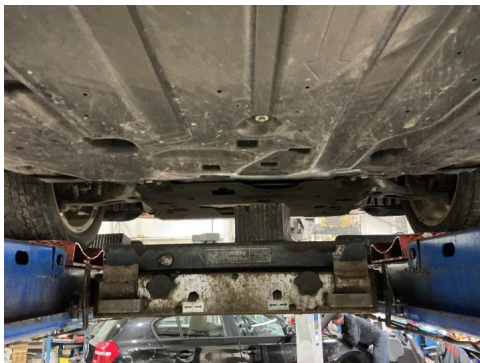

19. Generelt

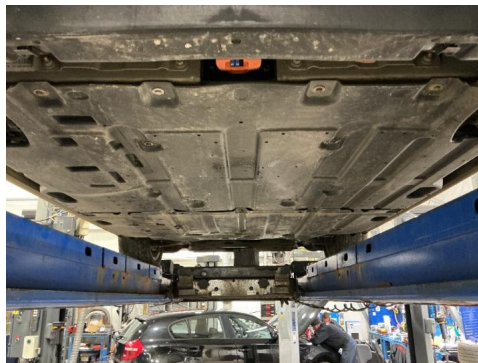


20. Generelt

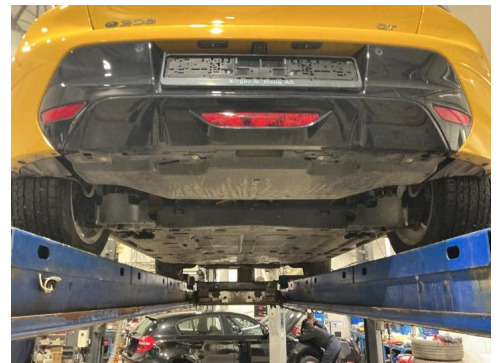


21. Generelt



22. Bremseskiver

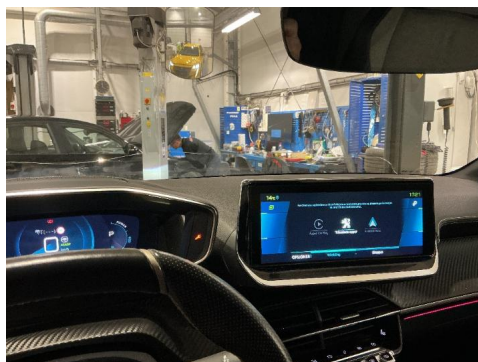

R 23. Frontrute

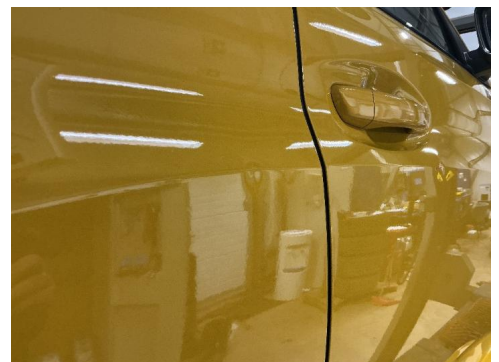


R 24. Høyre bakdør

R



6099070

Bilder og vedlegg

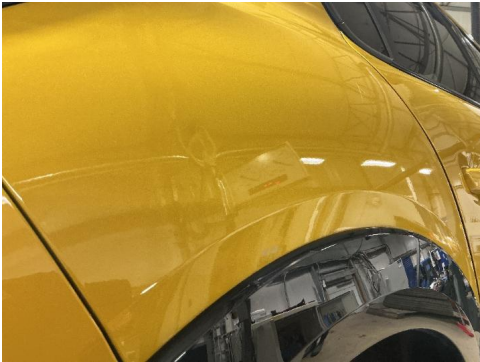

25. Høyre bakskjerm



R 26. Høyre bakskjerm



R 27. Høyre fordør


R



28. Varsellamper



R 29. Varsellamper

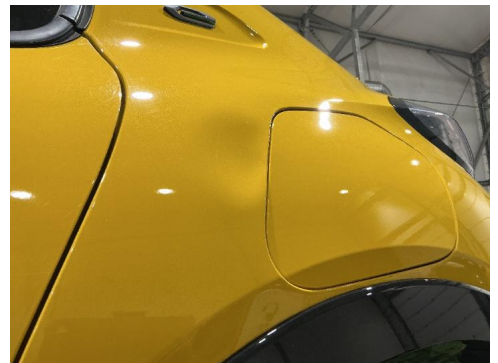

R 30. Venstre bakskjerm

R



Feilkodeutlesing

Analyse av kjøretøyets systemer

Reg.nr	VIN
EE15263	VR3UHZKXZMT046730
Årsmodell	Merke/Modell
19-	e-208-II
Motorkode	Km
ZKX	Ukjent

Utført med feil (178)

System	Feilkoder og Beskrivelse	
Airbag	B0020	Side airbag FL — Fault in electric circuit
	B1400	CAN bus — Faulty power supply
	U1F00	Diagnostic module — Error not recorded in error log
Automatic air conditioning	B1003	Air conditioning ECU — Faulty coding
Bosch ABS	C052B	ABS hydraulic pump — Function faulty.
	C1549	Parking brake actuator right — Function faulty.
	C154A	Parking brake actuator left — Function faulty.
	C156D	Electric parking brake — Faulty SENSOR
	P0562	ABS/ESP ECU — Fault in electric circuit
	P1702	System ECU — Run-on phase faulty
	U0103	CAN bus connection to transmission ECU — Communication disturbed
	U0294	Trouble codes — Fault code is not documented yet.
	U0401	CAN bus connection to powertrain control module — Communication disturbed
Central ECU of electric drive chain/ hybrid drive chain	P0560	Vehicle electrical system battery — Function faulty.
	P0C3C	DC-DC converter temperature sensor — Function faulty.
	P1081	High-voltage battery module charger/DC-DC converter — Function faulty.
	P1093	High-voltage battery module water pump — Function faulty.
	P13BA	Vehicle electrical system battery — Function faulty.
	U0415	CAN bus connection from ABS control unit — Communication disturbed
	U0422	CAN bus/connection to body control module — Communication disturbed
	U128A	ECU of vehicle electrical system battery 1 — Function faulty.
	U12DE	CAN bus connection to DC-DC converter ECU — Communication disturbed
	U2FFF	Ignore fault code — FC has not been specified by vehicle manufacturer!
Central switch unit BSI (CAN)	B1137	Dipped beam right — Fault in electric circuit
	B1138	Dipped beam left — Fault in electric circuit
	B1153	WINDSCREEN WIPER — Function faulty.
	B115B	Motor for rear-window wiper — Function faulty.
	B115E	Rear wiper — Function faulty.
	B1163	Licence plate light — Function faulty.
	B117C	Lateral exterior lights — Faulty control
	B1188	Windscreen wiper relay — Function faulty.



Feilkodeutlesing

Analyse av kjøretøyets systemer

System

Feilkoder og Beskrivelse

B1189	Windscreen wiper relay — Function faulty.
B118E	High beam relay control circuit — Fault in electric circuit
B1220	CAN bus connection to cruise control ECU — Received invalid data
B12BA	Release request electric drive motor front axle — Release not granted
B1325	Air-conditioning blower front — Fault in electric circuit
B1328	Actuation of rear window/exterior mirror heating — Function faulty.
B133D	Activation of relay for power window front — Fault in electric circuit
B133E	Power window relay rear — Fault in electric circuit
B1623	Relay of term. 15 — Function faulty.
B1627	Battery charge condition ECU — Function faulty.
B162B	Comfort CAN bus — Faulty control feed of relay!
B1715	Door lock contact FR — Implausible CONDITION
B1716	Door lock contact FL — Implausible CONDITION
B1718	Remote control — Faulty synchronisation
B173A	Door lock switch driver door — Implausible CONDITION
B1860	Parking brake switch — Fault in electric circuit
B1864	Brake pedal switch 2 — Fault in electric circuit
U0100	CAN bus connection with engine/powertrain control module — Communication disturbed
U1810	CAN bus connection between keyless entry and start system and body control module — Communication missing/incorrect
U1811	CAN bus connection between keyless entry and start system and body control module — Authentication incorrect
U1F00	Diagnostic module — Error not recorded in error log
U1F05	Condition of remote activation line — Function faulty.
U1F14	Body CAN bus — Communication disturbed
U1F15	Infotainment CAN bus — Communication disturbed
U1F1A	LIN bus — Communication faulty
U1F1B	LIN bus — Communication faulty
U1F1E	LIN bus 4 — LIN bus activation implausible
U1F22	CAN communication with park assist — Communication disturbed
U1F25	CAN bus connection to instrument cluster — Communication disturbed
U1F27	Infotainment control/display unit — Communication faulty
U1F28	Switch module under steering wheel — Communication disturbed
U1F30	Hands-free system — Communication disturbed
U1F32	Control module of driver door — Communication faulty
U1F36	CAN communication with service module/telematics ECU — No communication
U1F38	Function display in instrument cluster — Communication faulty
U1F39	Sensor for rain-/light recognition — Communication faulty
U1F3B	CAN communication with multifunction ECU/belt warning indicator light — No communication possible
U1F3E	Telematics ECU — Communication faulty
U1F40	Battery monitoring ECU — Communication disturbed
U1F42	Air conditioning ECU — Communication faulty
U1F43	Communication with airbag ECU — Communication disturbed
U1F53	Steering lock module — Communication faulty
U1F5E	CAN communication with radiator shutter ECU — No communication
U1F85	LIN bus 4 — Communication faulty
U1FA7	CAN communication with ECU of seat heater/seat ventilation FR — No communication on data line!
U1FA9	CAN communication with ECU of seat heater/seat ventilation FL — No communication on data line!



Feilkodeutlesing

Analyse av kjøretøyets systemer

System	Feilkoder og Beskrivelse	
Contact switch of vehicle electrical system battery 1	U1108	CAN bus connection to engine ECU — No communication
	U1208	CAN bus connection to engine ECU — No communication
Courtesy lights LED	B1400	CAN bus — Faulty power supply
	U1EF0	CAN bus connection between body control module and ECU of cabin LEDs — Communication faulty
Electr. power steering	C120D	Steering-angle sensor — Signal faulty
	C1644	Voltage supply — Faulty power supply
	U1213	CAN bus connection to ABS/ESC control unit — Communication disturbed
Headlight levelling	U0073	LED headlight ECU — Function/electric circuit faulty
Instrument cluster	B1534	Function display in instrument cluster — Function faulty.
	B1549	Instrument cluster display backlighting — Fault in electric circuit
	U1F00	Diagnostic module — Error not recorded in error log
	U1FA0	Audio-/ video connections — Communication disturbed
Internal drive battery charging device	P0562	DC-DC converter — 12 V side of voltage value incorrect.
	P12DC	Voltage sensor of Plug locking mechanism of high-voltage charge terminal — Function/electric circuit faulty
	P166C	Locking actuator of high-voltage charge terminal — Function faulty.
	U0079	CAN bus system for hybrid — Communication missing/incorrect
	U1187	CAN bus connection to powertrain control module — Communication disturbed
	U11A0	CAN bus connection to high-voltage battery module ECU — Communication disturbed
Keyless access	U2000	CAN bus — Main wake-up function faulty
Keyless access	B1004	ECU — Internal fault
	U1F00	Diagnostic module — Error not recorded in error log
Multi-function camera	B100C	ECU — Supply voltage faulty
	B1238	Multi-function camera — Field of view partly/entirely restricted
	U1208	CAN bus connection to engine ECU — Communication disturbed
	U1262	CAN bus connection with adaptive cruise control — Communication faulty
	U1F00	Diagnostic module — Error not recorded in error log
Multifunction touch screen	B1574	Touch screen — Voltage supply circuit faulty
	B1576	Multifunction display unit — Coding missing or faulty
	U1FA0	Audio-/ video connections — Communication disturbed
Navigation system	B1003	ECU remote coding — Coding missing or faulty
	B100C	ECU voltage supply — Faulty power supply
	B1505	Microphone input — Function faulty.
	B1506	Telematics ECU — Communication faulty
	B1513	Amplifier — Function faulty.
	B1560	USB port 4 — Function faulty.



Feilkodeutlesing

Analyse av kjøretøyets systemer

System

Feilkoder og Beskrivelse

	U18A1	CAN bus connection to telematic control unit — Communication faulty
	U1F03	CAN bus/connection to body control module — Communication disturbed
Parking assist	B1219	Electron. power steering — Function faulty.
	B121A	Body control module — Configuration faulty
	B1221	Distance sensor FL inner side — Function faulty.
	B1222	Distance sensor FL outside — Function faulty.
	B1223	Parking aid sensor rear inside left — Function faulty.
	B1224	Distance sensor rear outside left — Function faulty.
	B1225	Distance sensor FR inner side — Function faulty.
	B1226	Distance sensor FR outside — Function faulty.
	B1227	Distance sensor RR inner side — Function faulty.
	B1228	Distance sensor rear outside right — Function faulty.
	B1244	Distance sensor RL lateral — Function faulty.
	B1245	Distance sensor rear right — Function faulty.
	B1250	Distance sensor front left — Function faulty.
	B1251	Distance sensor front right — Function faulty.
	U0293	CAN bus connection to powertrain control module — No communication
	U1003	CAN bus — Function shut down
	U1109	CAN bus connection to transmission ECU — Communication disturbed
	U1804	Steering-angle sensor — Signal faulty
	U1F00	Diagnostic module — Error not recorded in error log
	U1F0F	CAN bus — Communication disturbed
	U1F18	Touch screen — fault of CAN connection
	U1F3E	Telematics ECU — Communication faulty
	U1F49	CAN bus connection to power steering ECU — Communication disturbed
Shift paddles	U1208	CAN bus connection to engine ECU — Communication disturbed
Steering wheel switch module	B100C	ECU — Supply voltage faulty
	U1F00	Diagnostic module — Error not recorded in error log
	U1F03	CAN bus connection to body control module — No communication
Traction battery	P0560	12 V voltage supply — Function faulty.
	P0562	12 V voltage supply — Function faulty.
	P1AEA	Electric circuit disconnect switch — Interruption in electric circuit
	U12DE	CAN bus connection to DC-DC converter ECU — Communication disturbed
Vehicle distance assistance	B12A8	CAN bus/data cable between emergency brake assistant and ABS/ESC control unit — Communication disturbed
	B12A9	CAN bus connection between cruise control and electronic stability control — Communication missing/incorrect
	U1148	CAN bus connection to engine ECU — No communication
	U1158	CAN bus connection to body control module — No communication
	U1F00	Diagnostic module — Error not recorded in error log



Feilkodeutlesing

Analyse av kjøretøyets systemer

Utført uten feil (19)

System	Beskrivelse
ABS	Bosch ABS
Airbag	Service module (automatic emergency call)
Comfort	Control tip switch at steering wheel
	Courtesy lights LED
	Driver door module
	Headlight levelling
	Instrument cluster
	Keyless access
	Multiplex operating unit
	Parking assist
	Sensor for rain-/light recognition
	Steering wheel switch module
Engine	Central ECU of electric drive chain/hybrid drive chain
	Electric motor
	Internal drive battery charging device
	Traction battery
Safety	Multi-function camera
	Vehicle distance assistance
Steering	Electr. power steering