



6134805

NAF Bruktbiltest

Testdato
09.03.2026

Kunde

Navn	Auksjonen.no Co/Santander
Medlemsnummer	95140190
Adresse	Døvlevei 23
Postnummer og -sted	3170 SEM
Telefon	33300540
Ekstern referanse	571266



Kjøretøy

Bilmerke	Volkswagen	Motorstørrelse	- cm ³
Modell	ID.3 PRO 150 KW	Motoreffekt	150 kW
Type	E1	Aksler i drift	1
Registreringsnr.	EB77656	Drivstofftype	Elektrisk
Understellsnr.	WVWZZZE1ZMP009464	Kjøretøygruppe	101
Km.stand.	27306	Bruktimportert	Nei
Farge	Grå	Registreringsår	2020
Karosseritype	Stasjonsvogn	Registrert første gang	30.09.2020
		Frist for neste EU kontroll	29.09.2024



Informasjon

NAF Bruktbiltest (BBT) er en uavhengig vurdering av kjøretøyets tekniske tilstand iht. definerte kontrollpunkter. De aktuelle kontrollpunktene fremkommer i testen og vurderes / bedømmes etter NAF sine definisjoner og retningslinjer som også hensyntar bilens alder og km-stand.

NAF anmerker kun feil, mangler og avvik som avdekkes på testtidspunktet. Forutsetninger for utført test er angitt på side 2 i denne rapporten. NAF demonterer ikke for kontroll. Det kan være indikasjon knyttet til tekniske forhold som krever ytterligere utredning for å kunne fastslå omfang. Det kan også være periodiske feil som ikke kan avdekkes på testtidspunktet. Se utfyllende leveransebeskrivelse side 6.

NAF Bruktbiltest er utført på oppdrag av bilforhandler. Alle henvendelser til testen og øvrige forhold til bilens tekniske tilstand må avklares mellom kjøper av bilen og bilforhandler testen er utstedt til.



6134805

Testresultater

Ref.Id	Repareres	Resultat	Beskrivelse
3.3	Nøkler / Utstyr	Nøkkel mangler 1 stk	
4.8	Service/ Dokum.	Aktivert serviceindikator	
4.9		Frist for EU kontroll er overskredet	
62.2	Ladekabel elbil/hybrid	Ladekabel mangler	
67.8	Ekstra hjulsett	Ekstra hjulsett mangler	
86.2	Lakk / karosseri utvendig	Lakkriper:	Venstre bakdør
98.2	Seter	Misfarget/skittent:	Venstre foran, Høyre foran, Venstre side bakerst, Midtre bakerst, Høyre side bakerst
101.3	Bagasjeromstildekning	Mangler:	Rollo, Hattehyll

Ref.Id	Opplysning	Resultat	Beskrivelse
6.16	Bremseskiver	Overflaterust eller mindre enn 25% av overflaten rustet	Begge sider foran
23.4	Full systemskann	Det finnes feilkoder, se rapport	
23.6		Etter avtale med kunde er feilkode/r slettet, feilsøking må påregnes dersom feilkode dukker opp igjen	
23.7		Diagnoseavlesing ligger i testrapport	
50.15	Varmeapparat / klimaanlegg (AC)	Kjølefunksjon er ikke funksjonsprøvd grunnet for lav utetemperatur	
77.14	Fjærer / fjærbein	* - Montert Luftfjærer og godkjent av statens vegvesen.	
81.9	Frontrute	Noe steinsprut	
102.9	Laste-/bagasjerom	* - Ettermontert luftfjærer, beholder i lasterom.	

Ikke utførte

Punkt	Årsak
Kjøreegenskaper	Bilen har feil dekk i forhold til årstid/føreforhold

Servicehistorikk

Bilen har elektronisk servicedokumentasjon. Bilde er vedlagt.

Testforhold

**Bilen har ikke blitt prøvekjørt
pga:**

Dekk iht årstid.



6134805

Prøvekjøring		Elektriske anlegg	
1 - Kjøreegenskaper		44 - Instrument belysning	✓
Generell informasjon		45 - Instrumenter	✓
3 - Nøkler / Utstyr	R	47 - Elektrisk vindusheis	✓
4 - Service/ Dokum.	R	48 - Oppvarmet bakrute	✓
Bremser		49 - Kupevifte	✓
5 - Bremsbelegg	✓	50 - Varmeapparat / klimaanlegg (AC)	O
6 - Bremseskiver	O	51 - Vindusvisker, spyler (foran/bak)	✓
7 - Bremsetromler	✓	53 - Sentrallås	✓
8 - Parkeringsbrems	✓	54 - Setevarmer	✓
9 - Bremsevirkning	✓	55 - Ladespenning generator	✓
10 - Bremsevæsknivå	✓	57 - Batteri ytre tilstand	✓
12 - Bremserør	✓	61 - Ladekontakt elbil/hybrid	✓
13 - Bremseslanger	✓	62 - Ladekabel elbil/hybrid	R
14 - Bremskraftforsterker	✓	63 - Kabler for fremdriftssystem elbil/hybrid	✓
15 - Brems pedal	✓	64 - Utv. tilstand fremdriftsbatteri elbil/hybrid	✓
Lys og signaler		Hjul, dekk, felg	
17 - Lys	✓	65 - Dekk	✓
19 - Refleks	✓	66 - Felg	✓
20 - Lyd / lyssignaler	✓	67 - Ekstra hjulsett	R
21 - Varsellamper	✓	68 - Hjullager	✓
e-Diagnose		Styring	
23 - Full systemskann	O	71 - Ratt, rattaksel, ledd	✓
Motor		72 - Styresnekke, tannstang	✓
27 - Motor virkemåte	✓	73 - Styrestag/ledd	✓
28 - Utvendig tilstand motor	✓	74 - Styreservo	✓
30 - Kjølevæske	✓	Hjuloppheng	
32 - Kjølesystem	✓	75 - Støtdempere	✓
35 - Motorfester	✓	76 - Stabilisator	✓
Drivverk		77 - Fjærer / fjærbein	O
40 - Girkasse (automatisk)	✓	78 - Opphengs- / bærearmer foraksel	✓
42 - Drivaksler	✓	79 - Opphengs- / bærearmer bakaksel	✓
		80 - Travers	✓



6134805

Karosseri

81 - Frontrute	O
82 - Siderute/bakrute	✓
83 - Dør-/panseråpner	✓
84 - Lås	✓
86 - Lakk / karosseri utvendig	R
87 - Utvendig speil	✓
88 - Underside	✓
89 - Understellsnummer	✓

Interiør

91 - Dashbord / midtkonsoll	✓
93 - Taktrekk	✓
95 - Innvendig speil	✓
96 - Dørtrekk	✓
97 - Døråpning	✓
98 - Seter	R
99 - Bilbelte	✓
100 - Gulvmatter/-teppe	✓
101 - Bagasjeromstildekning	R
102 - Laste-/bagasjerom	O
103 - Interiør generelt	✓



6134805

Måleverdier

Ref.Id	Punkt	Fråse	Måleverdi
3.1	Nøkler / Utstyr	Antall nøkler:	1 stk
6	Bremseskiver		Kontrollert visuelt
9.1	Bremsevirkning	Bremsevirkning, VF	250,00
9.2		Bremsevirkning, HF	250,00
9.3		Bremsevirkning, VB	200,00
9.4		Bremsevirkning, HB	200,00
30.1	Kjølevæske	Kjølevæskens frysepunkt, frostsikker ned til minus:	40 °C
50	Varmeapparat / klimaanlegg (AC)		Ikke målt pga. for lav utetemperatur
55.1	Ladespenning generator	Ladespenning med last (V)	14,50 volt
55.2		Ladespenning uten last (V)	14,50 volt
62.1	Ladekabel elbil/hybrid	Antall ladekabler i bilen:	0 stk
65.1	Dekk	Mønsterdybde VF	6,00 mm
65.2		Mønsterdybde HF	6,00 mm
65.3		Mønsterdybde VB	5,00 mm
65.4		Mønsterdybde HB	5,00 mm
65.5		Bilen er utrustet med:	Sommerdekk
66.1	Felg	Felg montert på bilen:	Lettmetallfelg
67	Ekstra hjulsett		Ikke målt grunnet manglende tilgjengelighet



6134805

Leveransebetingelser

1. Testrapporten

Testrapporten inneholder identifikasjon av kjøretøy og kunde samt beskrivelse av testens omfang med måleresultater der det foreligger.

2. Bedømming–vurderingsdefinisjon

Forklaring til bokstavkodene som benyttes ved PDF rapport:

V = Normalt. Tilstand vurdert «normal» iht. kjøretøyets alder og kjørelengde

R = Reparasjon. Anbefaler utbedring iht. kontrollpunkt

O = Opplysning. Informasjon iht. kontrollpunkt og/eller kjøretøy

S = Skiftet. Kontrollpunkt inkl. komponentskifte

J = Justert. Kontrollpunkt inkl. justering

I = Ikkeutført. Kontrollpunkt ikke vurdert

3. Gjennomføring av test.

Test utføres på et NAF Senter hvis ikke annet er beskrevet.

4. Eiendomsrett

Testens resultat tilhører NAFs kunde. Kundens navn er registrert på side 1 i testrapporten, og eventuelle henvendelser i forbindelse med testen må utføres av registrert kunde. Testresultatene leveres ikke ut til andre uten samtykke fra NAFs kunde.

5. Demontering

NAF demonterer ikke for kontroll/vurdering, og kan dermed ikke påpeke feil som kun avdekkes ved demontering. Dersom NAF oppdager avvik der det trengs demontering for kontroll/vurdering, vil dette anmerkes i testrapporten.

6. Prøvekjøring, periodiske feil og fremtidige problemer

NAF anmerker kun feil og avvik som oppdages på testtidspunktet. Periodiske feil/avvik kan forekomme uten at dette avdekkes pga. manglende symptom(fremtredelse) ved testtidspunktet. Det er ikke mulig å forutse framtidige problemer, feil eller avvik.

NAF prøvekjører bilen kun i begrenset grad.

7. Avlesing av elektronisk lagrede feilkoder via kjøretøyets OBD kontakt

NAF leser feilkoder på de elektroniske styresystemene som bilprodusenten har gitt tilgang til. Tilgang kan variere mellom ulike bilmerker og modeller og systemene leses med det testutstyret som benyttes av NAF. Det skilles ikke mellom permanente og periodiske feilkoder. NAF kan ikke påvise avvik i bilens oppgitte kilometerstand ved hjelp av diagnose.

8. NAFs ansvar

NAF har vurdert alle kontrollpunkter i den aktuelle testrapporten i henhold til NAFs definisjoner og retningslinjer. Kontrollpunkter som ikke omtales i rapporten er ikke inkludert eller vurdert.

Feil/avvik som avdekkes i etterkant av testen, kan ikke lastes NAF uten at det dokumenteres at følgende kumulative vilkår foreligger:

- feil/avvik må anses å ha foreligget ved testtidspunktet
- feil/avvik kan avdekkes etter gjeldende definisjoner og retningslinjer(innhold) av kontrollpunkt ved testtidspunktet
- feil/avvik kan avdekkes ved benyttet testutstyr i NAF ved testtidspunktet
- feil/avvik kan avdekkes ved gjeldende testforutsetninger ved testtidspunktet
- feil/avvik medfører konsekvenstap
- NAF har opptrådt uaktsomt ved testtidspunktet

9. Klageadgang næringsmarked

Testens resultat tilhører NAFs kunde. Kundens navn er registrert på side 1 i testrapporten. Ved eventuelle uoverensstemmelser i forbindelse med levert dokumentasjon, skal kunde ta dette opp med NAF. NAF er forretningsmessig leverandør til kunde og forholder seg kun til denne avtalepart.

Alle reklamasjoner må være NAF i hende skriftlig senest 10 dager etter at testen er utført.

10. Reklamasjonsansvaret til NAF

Ved uoverensstemmelse mellom tekst og bilder i testrapport og ett av disse viser riktig tilstand, er feilen ikke reklamasjonsgrunn.

NAF AS er ikke ansvarlig for feil i opplysninger som er hentet elektronisk fra 3. -part.

NAF AS kan kreve at bilen stilles til disposisjon for kontroll.

Ved reklamasjon kan NAF AS forlange å få mulighet til å reparere på eget verksted.

Hvis kjøper starter reparasjon på annet verksted uten skriftlig godkjenning fra NAF AS bortfaller retten til å kreve utgiften refundert av NAF AS.

Ved reparasjon på kjøpers verksted beregnes priser etter NAF AS sine innkjøpspriser (Meca eller tilsvarende) og selvkost på timepris. Benyttes DBS-systemet som grunnlag for delepriser benyttes importørpriser uten fraktpåslag.

Arbeidstidsettes iht. Haynes Pro med faktor 1

Diagnoserapport vedlegges der kunden har bestilt dette. Diagnoserapporten betraktes som en del av testrapporten.

Reklamasjonskravets størrelse er under alle omstendigheter oppad begrenset til prisen på testen, med mindre noe annet er særskilt avtalt.

NAF AS anbefaler at budgivere selv inspiserer objektet.



6134805

Bilder og vedlegg



1. Generelt



2. Generelt



3. Generelt



4. Generelt



5. Generelt



6. Generelt



7. Generelt



8. Generelt



9. Generelt



10. Generelt



11. Generelt



12. Generelt



6134805

Bilder og vedlegg



13. Generelt



14. Generelt



15. Generelt



16. Generelt



17. Generelt




18. Generelt



19. Generelt



20. Generelt

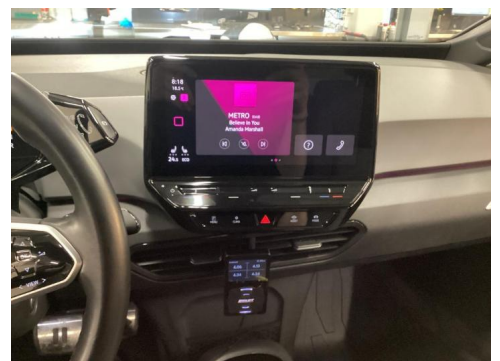

21. Generelt



6134805

Bilder og vedlegg



22. Generelt



23. Generelt



24. Generelt



25. Generelt



26. Generelt



27. Generelt



28. Generelt



29. Generelt



30. Generelt



6134805

Bilder og vedlegg



31. Generelt



32. Generelt



33. Generelt



34. Generelt



35. Generelt



36. Generelt



37. Generelt



38. Generelt




39. Generelt



6134805

Bilder og vedlegg

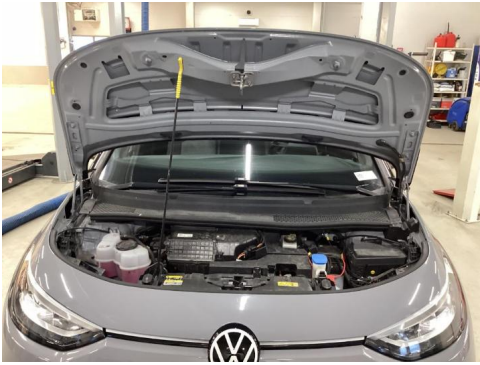

40. Generelt



41. Generelt




42. Generelt



43. Generelt



44. Generelt

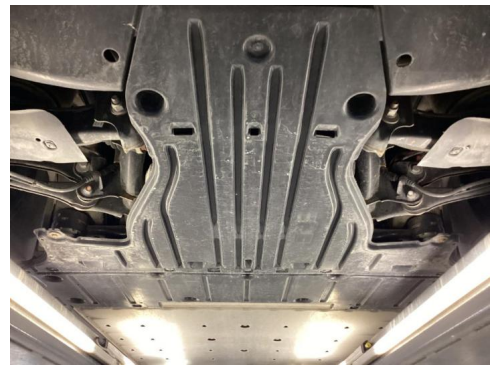

45. Generelt



Feilkodeutlesing

Analyse av kjøretøyets systemer

Reg.nr	VIN
EB77656	WVWZZZE1ZMP009464
Årsmodell	Merke/Modell
20-24	ID.3 Pro Performance
Motorkode	Km
EBJC	27 306

Utført med feil (206)

System	Feilkoder og Beskrivelse	
A/C/heater	B1ACB11	Air distribution flap actuator sensor right — Short circuit to ground
	U014600	CAN bus connection to central gateway ECU — Communication disturbed
	U101100	Voltage supply — Voltage too low
	U107600	Local data bus 2 — Fault in electric circuit
	U124400	Cabin air quality sensor — No communication
	U12DB00	CAN bus connection with engine ECU — Signal faulty
	U140000	Functional restriction — Function restricted due to undervoltage
	U15BA00	Body computer 1/ vehicle electrical system ECU/electron. ZE — Message faulty
Access and start system interface	U101100	Voltage supply — Voltage too low
Airbag	B101C07	Buckle switch driver side — Mechanical fault
	U112300	Data bus — Message faulty
Application server 3 system 1 infotainment	B10CD00	Functional restriction through battery monitoring ECU — System active
Brake boost	B200FF0	ECU — Internal fault
	C12E2F7	Parking brake actuator right — Requested position cannot be reached
	P056200	Voltage supply — Undervoltage registered
	U005600	Instrument cluster/suspension CAN — No communication
	U010000	CAN bus connection to engine ECU — No communication
	U012900	CAN bus connection from brake system ECU — Communication disturbed
	U014600	CAN bus connection to central gateway ECU — Communication disturbed
	U041500	CAN bus connection from brake system ECU — Signal implausible
	U044700	CAN bus connection to central gateway ECU — Signal implausible
	U112200	Data bus — Message implausible
	U12DC00	CAN bus connection from brake system ECU — Signal faulty
	U300100	ECU — Inadmissible cutoff
Brake electronics	C050000	Wheel speed sensor FL — Interruption in electric circuit
	C050600	Wheel speed sensor FR — Interruption in electric circuit
	C051200	Wheel rpm sensor RR — Interruption in electric circuit
	C052800	Steering-angle sensor — Signal implausible



Feilkodeutlesing

Analyse av kjøretøyets systemer

System

Feilkoder og Beskrivelse

	C05A400	Wheel speed sensors — Voltage supply too low
	C101C14	Wheel rpm sensor RL — Interruption or short circuit to ground
	C102D00	Tyre-pressure warning — Warning message active
	C123E00	Brake booster — Function faulty.
	P056100	Voltage supply — Instable voltage
	P056200	Voltage supply — Undervoltage registered
	U300100	ECU — Inadmissible cutoff
Diagn. interface bus	B131329	Brake light switch — Signal implausible
	B136676	Rain/light sensor — Faulty installation position
	B147A18	Remote key 2 — Voltage too low
	B163002	Distance data of navigation system — Signal faulty
	B17E0F0	Plug locking mechanism of high-voltage charge terminal — Function faulty.
	B1802F1	12 V battery management — Warning released
	B184C00	Trouble codes — Fault code is not documented yet.
	B18C6F0	High-voltage safety management — Emergency shut-off demanded
	B1AF9F0	High-voltage coordinator — Charging release missing.
	B1AF9F1	High-voltage coordinator — Not ready for charging
	C1249F6	High-voltage battery module charge management — Functional restriction due to safety functions
	P0CF400	Pilot conductor (charging interface) — Signal implausible
	P10BA00	Emergency charge function — Function active
	P15E900	Parking interlock disengaged (not locked). — Function faulty.
	P1A8500	12-V test pulse diagnostics — not possible
	P1BEC00	High-voltage charge terminal — Charging not possible.
	P1C8500	Emergency charge function — not possible
	P1CC300	High-voltage charge terminal — Function faulty.
	P30F400	Vehicle electrical system battery — Balancing charge though high-voltage battery module faulty
	U101100	Voltage supply — Voltage too low
	U10E000	Front sensor systems of driver assist systems — No communication
	U111100	CAN bus — Missing message
	U112100	Data bus — Missing message!
	U112200	Data bus — Message implausible
	U140000	Functional restriction — Function restricted due to undervoltage
	U140A00	Terminal clamp 30 — Interruption in electric circuit
	U14A800	Ethernet connection, section 11 — Communication disturbed
	U14FE00	Secure on-board communication — Signature check failed
	U15FA00	EgoMaster — Input data faulty
	U162600	Heating load control — Signal implausible
	U166200	Application server 1 system 2 Java — Internal fault
	U166300	Application server 3 system 1 infotainment — Communication disturbed
	U173E00	Passenger detection — Functional restriction due to implausible message
Display unit driver display	U101100	Voltage supply — Voltage too low
Driver door electronics	B131FF5	Power window driver side rear — Under- or excess voltage is determined!
	U101100	Voltage supply — Voltage too low
	U101300	ECU — Not coded!
Dynamic light strip 1	U101100	Voltage supply — Voltage too low



Feilkodeutlesing

Analyse av kjøretøyets systemer

System	Feilkoder og Beskrivelse	
Electric drive 1	P056200	Voltage supply — Undervoltage registered
	P0A1B00	Electric drive power electronics — Function faulty.
	U112300	Data bus — Message faulty
	U300100	ECU — Inadmissible cutoff
Electron. steering column locking	U101100	Voltage supply — Voltage too low
Emergency call system/telematics system	U101100	Voltage supply — Voltage too low
	U140000	Functional restriction — Function restricted due to undervoltage
	U14FE00	Secure on-board communication — Signature check failed
Engine electronics I	P056800	Cruise control — Set signal faulty (Set)
	P060C00	ECU — Internal fault
	P064F00	ECU — Faulty software
	P068A00	Main relay — Relay opens too early.
	P0A0A00	High-voltage safety circuit — Loose contact/interruption
	P0A0B00	High-voltage safety circuit — Signal implausible
	P0A9400	DC-DC converter — No power/malfunction.
	P164700	Powertrain control modules — Version coding faulty
	P253200	Ignition switch position "Ignition ON" — Voltage supply high
	P2D8900	Radiator fan ECU 1 — Voltage supply circuit faulty
	P2EAC00	ECU 1 active radiator ventilation — Function faulty.
	U010300	CAN bus connection to electronic selector lever module — no signal / communication
	U012100	CAN bus connection from brake system ECU — Communication disturbed
	U013100	CAN bus connection to power steering ECU — Communication disturbed
	U041100	CAN bus connection to electric drive motor ECU A — Missing message
	U041300	Battery management 2 — Signal implausible
	U041500	CAN bus connection from brake system ECU — Signal implausible
	U041600	CAN bus connection to ABS/ESC control unit — Received invalid data
	U044700	CAN bus connection to central gateway ECU — Signal implausible
	U112200	Data bus — Message implausible
	U112300	Data bus — Message faulty
	U122900	Driver assist system camera — Signal implausible
	U303500	Verification of communication monitoring — Signal faulty
	U350100	ECU voltage supply 1 — Voltage too low
Front camera system	U112100	Data bus — Missing message!
	U112300	Data bus — Message faulty
High-voltage battery charger	B1AD0F0	Charging station recognition — Function faulty.
	P062F00	ECU — Internal fault
	P1CF400	Plug locking mechanism of high-voltage charge terminal 1 — Component blocked
	U101100	Voltage supply — Voltage too low
	U112100	Data bus — Missing message!
	U140000	Functional restriction — Function restricted due to undervoltage
	U303500	Verification of communication monitoring — Signal faulty
Hybrid battery management	P056200	Voltage supply — Undervoltage registered



Feilkodeutlesing

Analyse av kjøretøyets systemer

System	Feilkoder og Beskrivelse	
	P0A8D00	14 V voltage supply — Voltage too low
Information electronics	B1297F5 B1297F6 U101100 U140000	Multimedia display unit 1 — Supply voltage too low Multimedia display unit 1 — Video connection faulty. Voltage supply — Voltage too low Functional restriction — Function restricted due to undervoltage
Light control left 2	U140000	Functional restriction — Function restricted due to undervoltage
Light control right 2	U140000	Functional restriction — Function restricted due to undervoltage
Parking assist	U112300	Data bus — Message faulty
Passenger door electronics	B1320F5 U101100	Power window passenger side rear — Under- or excess voltage is determined! Voltage supply — Voltage too low
Power steering	B1168F2 U101100 U140000 U140A00	Steering-angle sensor — Initialization faulty Voltage supply — Voltage too low Functional restriction — Function restricted due to undervoltage Terminal clamp 30 — Interruption in electric circuit
Radar sensor of adaptive cruise control	U040000 U112200 U112300	CAN bus — Received invalid data Data bus — Message implausible Data bus — Message faulty
Software cluster embedded 1	U177800	Application server 1 system 2 Java — Faulty software
Steering column module	U101100 U112100 U112300	Voltage supply — Voltage too low Data bus — Missing message! Data bus — Message faulty
Vehicle electrics 1	B136676	Rain/light sensor — Faulty installation position
Voltage transformer 12V	P056100 P056200 P0B3300 U010000 U014600 U300100	Voltage supply — Instable voltage Voltage supply — Undervoltage registered Service disconnect plug — Fault in electric circuit CAN bus connection to engine ECU — No communication CAN bus connection to central gateway ECU — Communication disturbed ECU — Inadmissible cutoff



Feilkodeutlesing

Analyse av kjøretøyets systemer

Utført uten feil (4)

System

Comfort

Beskrivelse

Actuator for exterior noise

Application server 1 system 1 adaptive

Application server 1 system 2 Java

Software cluster housekeeping 1